


# MONUMENT RECORD

Corner ID: **Wash\_Q01**

## Section Corner



Sections 2 & 3- T10N-R01W, 2nd P.M.  
Washington Township, Monroe County, Indiana

Morgan County

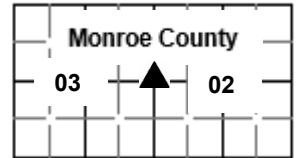

**MONUMENT:** Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)  
0.5' x 0.3' sandstone with small cut 'X' reset 0.7' above grade

### MONUMENT LOCATION SKETCH:

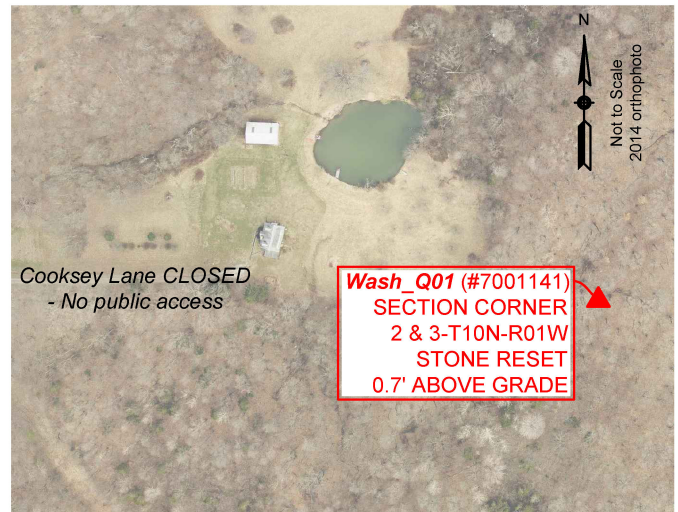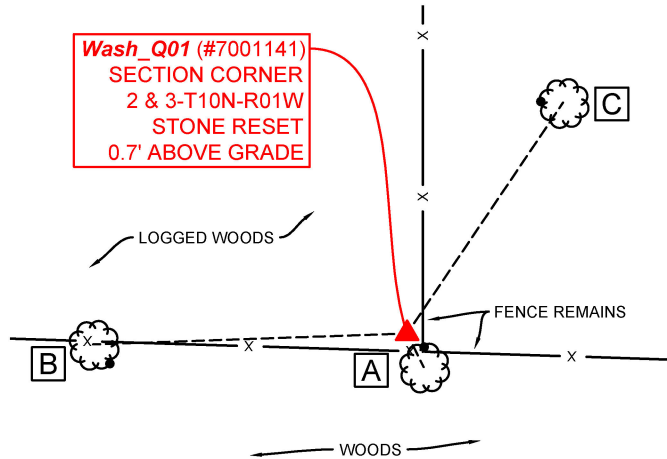

### WITNESS MONUMENT TIES

All ties to new Bearing Trees (BTs) are a mag nail set in a 1-1/2" plastic washer stamped "SURVEY MARKER - DO NOT REMOVE" and hack mark at the root crown (less than 12" above ground) perpendicular to the center of the tree, unless otherwise noted. BT diameters are noted as dbh and are measured approximately 4.5' above ground. Bearings are measured from the monument to the center of the BT, distances are measured from the monument to the mag nail.

ID	BEARING	DISTANCE	DESCRIPTION
Witness A	S 26d E	3.9'	Mag nail found 1.0' above grade in the north side of an 11" hickory with north/west/east fence remains
Witness B	S 88d W	32.7'	Mag nail and washer set in hack 0.5' above grade in the southeast side of a 17' shag bark hickory with east/west fence remains in the north side of the tree
Witness C	N 34d E	29.0'	Mag nail and washer set in hack 1.5' above grade in the west side of a 20" beech tree



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 1 of 3


# MONUMENT RECORD

Corner ID: **Wash\_Q01**

## Section Corner

Sections 2 & 3- T10N-R01W, 2nd P.M.  
Washington Township, Monroe County, Indiana

Morgan County

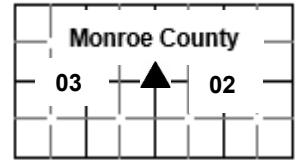

**PHOTO IDENTIFIED:** *Photo Date:* 10/07/2019



*Photo Orientation & Description:* Looking southwest at Wash\_Q01



*Photo Orientation & Description:* Looking west at Wash\_Q01



*Photo Orientation & Description:* Looking northeast at Wash\_Q01



*Photo Orientation & Description:* Looking southwest at Wash\_Q01

**EXISTING SURVEY HISTORY** *Include as much detail and history of the corner as known at the time of perpetuation*

### ORIGINAL GOVERNMENT SURVEY:

*Year Surveyed:* 12/11/1819 *By:* Theo Brown

*Where filed or recorded:* F\_EV01P318

*Original monument:* Post

*Bearing Trees or Reference Monuments:*

Species	Dia.	Bearing	Distance
W.Oak	4"	S 51° E	9.24'
Beech	7"	N 80° W	9.9'

*Notes:* 13 chains 21 links (871.86') east of the post corner to Sections 34 & 35 -T11N-R1W

### SUBSEQUENT CORNER RESTORATION:

*Date Surveyed:* 4/16/1902 *By:* L.Dillman, MCS

*Where filed or recorded:* MCSO LSB2, page 579

*Original monument:* Not noted, assumed stone

*Bearing Trees or Reference Monuments:*

Species	Dia.	Bearing	Distance
Hickory	3"	S 27.25° E	8.75'
Hickory	4"	S 79.5° E	28'

*Notes:* "Reestablished"

**OTHER SURVEY HISTORY:** *Include details such as surveyor name, date, recording info, monument description, etc.*

**ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND:** *Include, search area or areas, search procedure, etc.*

*Date of Field work/Search:* 10/07/2019 *By:* RSO *Monument Found:* stone *BTs or Reference Objects Found:* Located one witness from 1996 monument record. Stumps of other two witness trees were not retied. *Project #:* INDOTNetwork2019 *Field Book:* 53/70 *Notes:* This corner is very inaccessible. The stone was disturbed due to logging activity in the area. Stone was found broken on the ground. The base of the stone was solidly planted 0.7' below grade. After resetting the broken top on the solidly planted base, the southwest side of the top of the stone is 0.7' above grade. A 5/8" rebar with pink flagging was found 0.5' southeast of the stone, 0.2' above



**OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph**

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyorsoffice@co.monroe.in.us

Page 2 of 3




# MONUMENT RECORD

Corner ID: **Wash\_Q01**

## Section Corner

Sections 2 & 3- T10N-R01W, 2nd P.M.  
Washington Township, Monroe County, Indiana

Morgan County

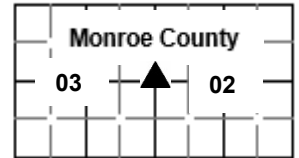

grade. We tested the stone with hydrochloric acid and it did not react, so we classified it as sandstone.

**OTHER EVIDENCE:** *Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.*

From the east end of Cooksey Lane (which is now closed), walk east for ~560 feet.

**MONUMENT PRESERVATION:** *Describe work done to preserve existing monument.*

Reset the stone 0.7' above grade on broken base with magnet buried on the southwest side of the stone. Built rock cairn around the stone and set a T-Post on the northwest side of stone with a "Protect Nearby Survey Marker" sign attached.

**THEORY OF LOCATION:** *Describe the theory of location for acceptance of this monument. Include monument origin and associated uncertainty.*

The stone was witnessed by the State Highway Survey Location Team on 7/25/1996 and was accepted by Monroe County Surveyor Michael Friley. The stone was subsequently accepted by Eric Deckard on a boundary survey for Pauley dated 3/16/2006 recorded as Instrument Number 2006008813 and a boundary survey for Reeves dated 8/28/2008 recorded as Instrument Number 2008016189. The stone was also accepted by Tracy McGill on the I69 Section 5, Segment 4 Route Survey recorded as Instrument Number 2013015455. In 2018, Chris Porter informed us that the stone had been disturbed by logging activity in the area, which is why we visited the monument.

**GEODETIC COORDINATES:** *Northing:* 1490314', *Easting:* 3117861'

**BASIS OF GEODETIC COORDINATES:** Coordinates were calculated based on point number #1141 from Section 5, Segment 4, Route survey recorded as Instrument Number 2013015455.

### CERTIFICATIONS:



*Rachel Oser* 9/29/2020  
Rachel Oser, Indiana PS 21100022



*Trohn Enright-Randolph* 9/24/2020  
Trohn Enright-Randolph, Monroe County Surveyor



Accepted by the Monroe County  
Surveyor Review Board on  
9/24/2020



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 3 of 3

# MONUMENT RECORD

Corner I.D. #

Q-1

STATE OF INDIANA - COUNTY OF MONROE

Section Three (3), Township 10 North, Range 1 West

Monument Description & Remarks: Corner located by State Highway Survey  
Location Team. See drawing below for description.

**Recovery Tie Drawing**

N.E. Cor. Sec. 3, T-10 N, R-1 W  
WASHINGTON TWP. MONROE CO.  
ON MONROE - MONROE CO. LINE ± 2600' E OF SR 37

Type Monument 0.14 x 0.10 STONE  
 Depth 0.15m ABOVE GROUND  
 By LOCATION PARTY 1  
 Date 07-25-96

State Form 40180

● At Corner  
 N  
 Not To Scale

State of Indiana  
 County of \_\_\_\_\_

Space  
 Reserved For  
 Recording  
 Officer

I, M. J. L., hereby certify  
 that this document was prepared under my direction in  
 accordance with the provisions of Section 17-3-64-4  
 through 17-3-64-8 of the Indiana Code, being Acts of 1965,  
 Chapter 319; and the above data is given under my hand and  
 seal this \_\_\_\_\_ day of \_\_\_\_\_, 19\_\_\_\_ A.D.

Indiana Registered Land Surveyor No. \_\_\_\_\_ or

United States Government Agency

Title

Field Book:

Page: